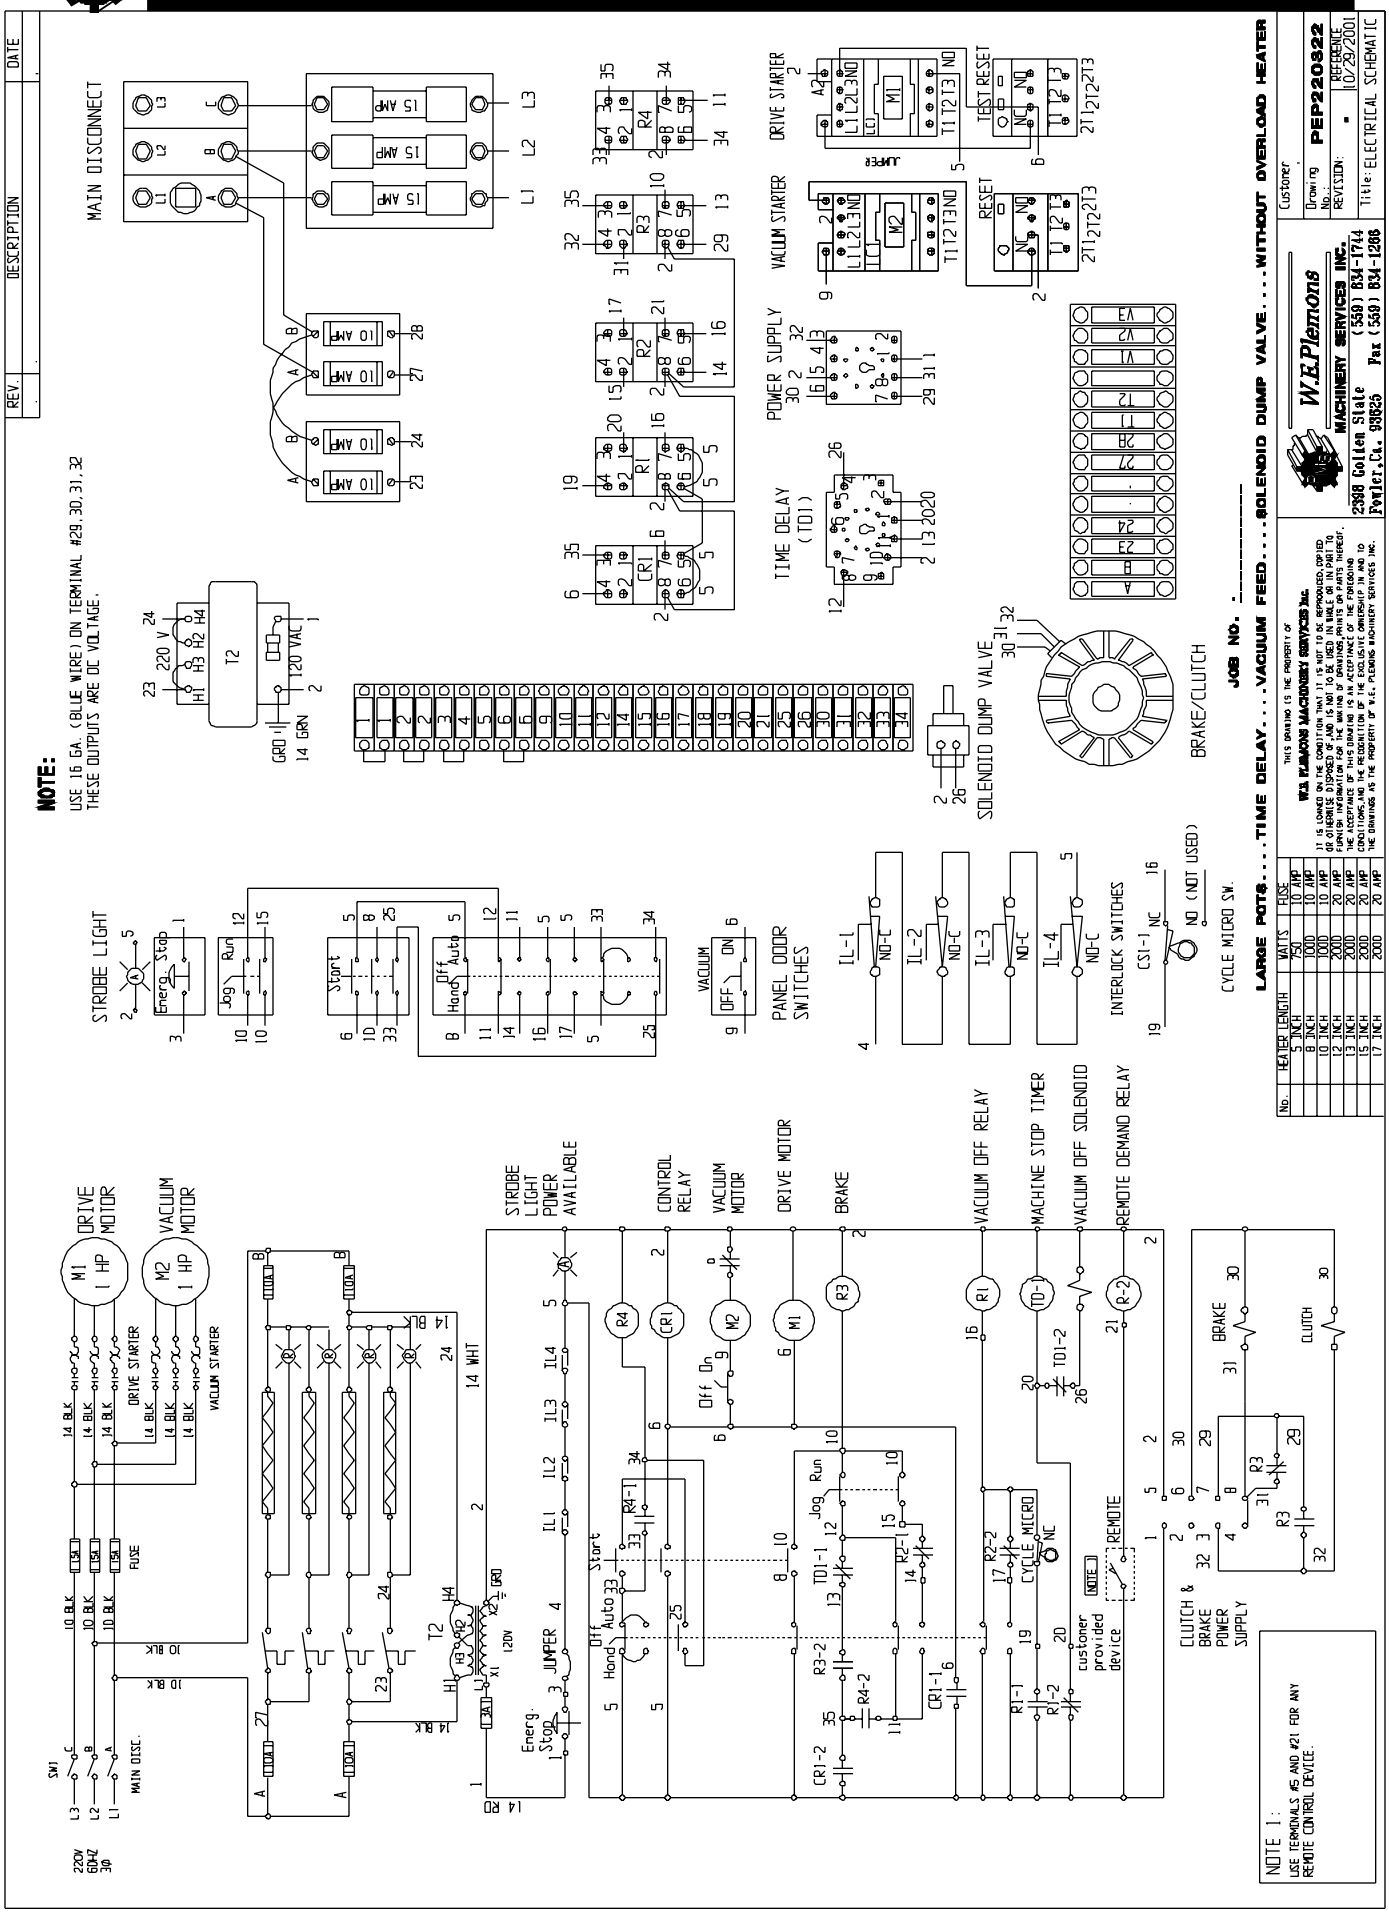
MAIN DISCONNECT
NOTE:
USE 16 GA. (BLUE WIRE) ON TERMINAL #29,30,31,32
THESE OUTPUTS ARE DC VOLTAGE.
DRIVE STARTER
VACUUM STARTER
TEST RESET
RESET
POWER SUPPLY
TIME DELAY (TD1)
SOLENOID DUMP VALVE
BRAKE/CLUTCH
STROBE LIGHT
PANEL DOOR SWITCHES
INTERLOCK SWITCHES
CYCLE MICRO SW.
LARGE POTS....TIME DELAY....VACUUM FEED....SOLENOID DUMP VALVE....WITHOUT OVERLOAD HEATER
JOB NO. :
W.E.Plemons
MACHINERY SERVICES INC.
2398 Golden State
Porter,Ca. 93625
(559) 834-1744
Fax (559) 834-1268
Customer
Drawing No.: PEP220322
REVISION: -
REFERENCE
10/29/2001
Title: ELECTRICAL SCHEMATIC
DRIVE MOTOR
VACUUM MOTOR
STROBE LIGHT POWER AVAILABLE
CONTROL RELAY
VACUUM MOTOR
DRIVE MOTOR
BRAKE
VACUUM OFF RELAY
MACHINE STOP TIMER
VACUUM OFF SOLENOID
REMOTE DEMAND RELAY
CLUTCH & BRAKE POWER SUPPLY
customer provided device
NOTE 1:
USE TERMINALS #5 AND #21 FOR ANY REMOTE CONTROL DEVICE.

PEP220322